

Test Report

Client: Geolam Management GmbH, Churerstraße 47, CH-8808 Pfäffikon Sz
 Job number: 6658

Sample Date:

2014-05-09 (mailing)

Samples:

Count	Name / No.
3 pieces	Profile: Geolam Type: Soleo 7025 Sample size: 130 x 50 x 30 mm curved Radius: 500 mm Color: ebony

Tests:

Name / Standard	Time	Equipment
Salt spray tests /DIN EN ISO 9227 NSS*	1000h	MSC 1000, Fa. Liebisch

Requirements:

-

Results:

Sample	Test	Time	Evaluation
3 pieces	NSS	240h	no visible change
		480h	slightly visible change, white spots are salt residues
		720h	Samples appear brighter than at the beginning and the wood surface is roughened.
		1000h	Samples appear brighter and matt than at the beginning and the wood surface is roughened.

Assessment:

-

Comments / Attachments:

Image documentation at the beginning, after 240h, 480h, 720h and 1000h testing.

Schwäbisch Gmünd, 2014-05-20



Laboratory manager/ Dr. Papendorf



Deputy of Laboratory manager/ W. Noack

Test Report

Client: Geolam Management GmbH, Churerstraße 47, CH-8808 Pfäffikon Sz
Job number: 6658

Image documentation

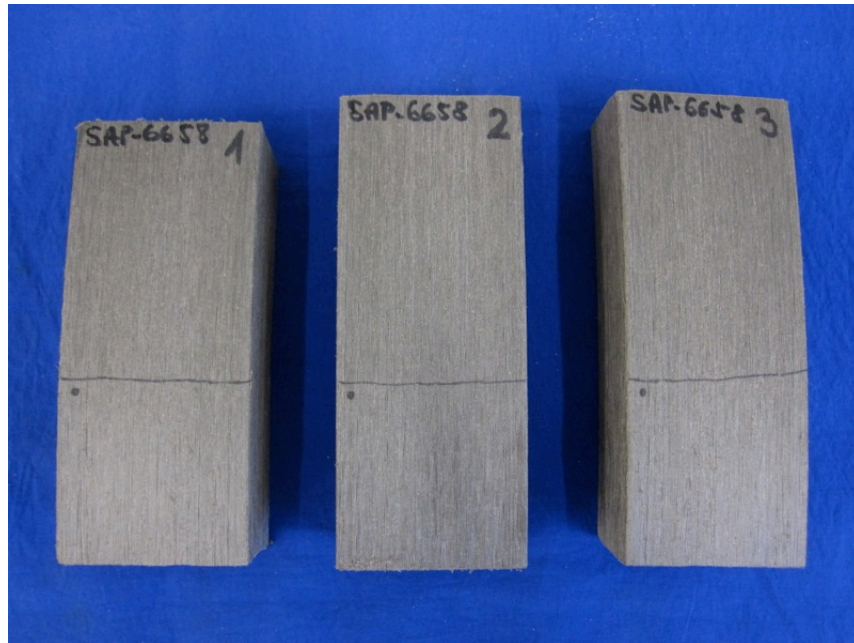


Image 1 – samples at the beginning



Image 2 – samples after 240h NSS

Test Report

Client: Geolam Management GmbH, Churerstraße 47, CH-8808 Pfäffikon Sz
Job number: 6658



Image 3 – samples after 480h NSS

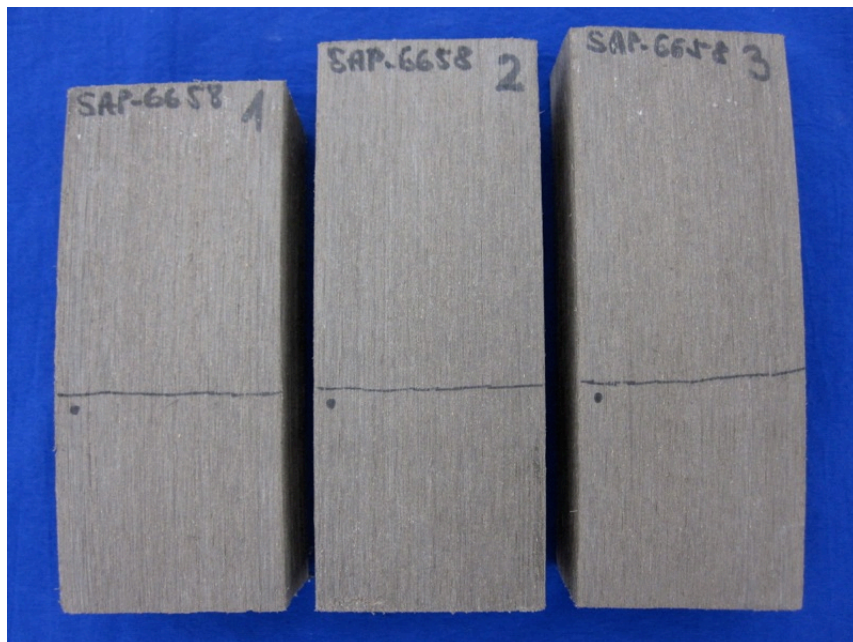


Image 4 – samples after 720h NSS

Test Report

Client: Geolam Management GmbH, Churerstraße 47, CH-8808 Pfäffikon Sz
Job number: 6658



Image 5 – samples after 1000h NSS